

Order No.: DD+DIS166.02E



1 piece VDRTQ MA1

**ADC Solo**

Type 5155 / 100

**Path Speed CR SP1001**

Type 5155 / 200


Rating			When?		
safety relevant	reliability	new function	immediately	next service	as required
	X				X

Please file this document in section 13 of your technical documentation

## Replacement of a broken light barrier flag at the Cassette Opener

### Symptom

The light barrier flag (see figure beside) of the cassette opener may break when it touches the frame of the cassette opener.

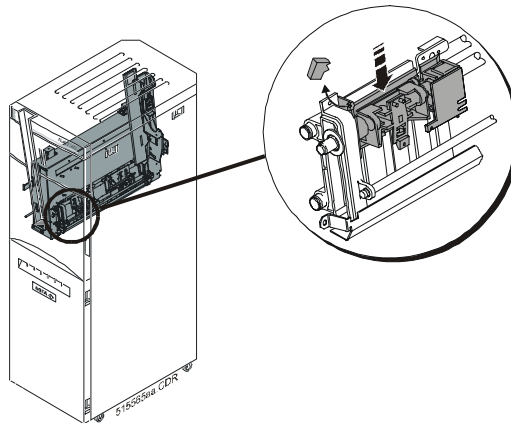

### Reason

The cassette opener (LHS) remains in the home position and is not moved to the middle position when the cassette holder is lowered manually.

### Solution

Exchange the broken part.

Order number: **CM+9.5146.5911.0**



Spare part can be ordered separately. It is not necessary to order a complete cassette opener!